



取扱説明書

2相ステッピングモーター PKPシリーズ

はじめに

■ お使いになる前に

製品の取り扱いは、適切な資格を有する人が行なってください。
お使いになる前に、「安全上のご注意」をよくお読みのうえ、正しくお使いください。
この製品は、一般的な産業機器の機器組み込み用として設計されています。
その他の用途には使用しないでください。また、電源には、一次側と二次側が強化絶縁された直流電源を使用してください。この警告を無視した結果生じた損害の補償については、当社は一切その責任を負いませんので、あらかじめご了承ください。

■ 有害物質

RoHS(EU 指令 2002/95/EC 27Jan.2003)適合

安全上のご注意

ここに示した注意事項は、製品を安全に正しくお使いいただき、お客様や他の人々への危害や損傷を未然に防止するためのものです。内容をよく理解してから製品をお使いください。



この警告事項に反した取り扱いをすると、死亡または重傷を負う場合がある内容を示しています。

- 爆発性雰囲気、引火性ガスの雰囲気、腐食性の雰囲気、水のかかる場所、可燃物のそばでは使用しないでください。火災・けがの原因になります。
- 設置、接続、運転・操作、点検・故障診断の作業は、適切な資格を有する人が行なってください。火災・けがの原因になります。
- 昇降装置に使用するときは、可動部の位置保持対策を行なってください。モーターは電源が OFF の時、保持力がなくなるため、可動部が落下してけが・装置破損の原因になります。
- モーターは筐体内に設置してください。けがの原因になります。
- 電源入力電圧は、定格範囲を必ず守ってください。火災の原因になります。
- 接続図にもとづき、確実に接続してください。火災の原因になります。
- コネクタ部を無理に曲げたり、押さないでください。火災の原因になります。
- モーターリード線を無理に曲げたり、引っ張ったり、挟み込まないでください。火災の原因になります。
- 電源には、一次側と二次側が強化絶縁された直流電源を使用してください。感電の原因になります。
- 停電したときは、電源を切ってください。停電復旧時にモーターが突然起動して、けが・装置破損の原因になります。
- モーターを分解・改造しないでください。けがの原因になります。内部の点検や修理は、お買い上げになった支店または営業所に連絡してください。



この注意事項に反した取り扱いをすると、傷害を負うまたは物的損害が発生する場合がある内容を示しています。

- モーターの仕様値を超えて使用しないでください。けが・装置破損の原因になります。
- 運転中および停止後しばらくの間は、モーターに触れないでください。モーターの表面が高温のため、やけどの原因になります。
- モーター出力軸、モーターリード線を持たないでください。けがの原因になります。

お買い上げいただきありがとうございます。

この取扱説明書には、製品の取り扱いかたや安全上の注意事項を示しています。

- 取扱説明書をよくお読みになり、製品を安全にお使いください。
- お読みになったあとは、いつでも見られるところに必ず保管してください。

- 装置の故障や動作の異常が発生したときは、装置全体が安全な方向へはたらくよう非常停止装置、または非常停止回路を外部に設置してください。けがの原因になります。
- 絶縁抵抗測定、絶縁耐圧試験は、モーターとドライバそれぞれで行なってください。モーターとドライバを接続した状態で、絶縁抵抗測定、絶縁耐圧試験を行なうと、製品が破損するおそれがあります。
- 運転中は回転部(出力軸)に触れないでください。けがの原因になります。
- 異常が発生したときは、ただちに運転を停止して、ドライバの電源を切ってください。火災・けがの原因になります。
- モーターを廃棄するときは、できるだけ分解し、産業廃棄物として処理してください。

製品の確認

次のものがすべて揃っていることを確認してください。不足したり破損している場合は、お買い求めの支店・営業所までご連絡ください。

製品が正しいか、製品の銘板に記載された品名で確認してください。

- モーター 1 台
- 接続ケーブル(0.6 m) 1 本(PKP2□-L のみ)
- * □には、モーターの種類を表わす英数字が入ります。
- 取扱説明書(本書) 1 部

設置

■ 設置場所


モーターは機器組み込み用に設計・製造されています。風通しがよく、点検が容易な次のような場所に設置してください。

- 屋内に設置された筐体内(換気口を設けてください)
- 使用周囲温度 -10~+50 °C(凍結しないこと)
- 使用周囲湿度 85%以下(結露しないこと)
- 爆発性雰囲気、有害なガス(硫化ガスなど)、および液体のないところ
- 直射日光が当たらないところ
- 塵埃や鉄粉などの少ないところ
- 水(雨や水滴)、油(油滴)、およびその他の液体がかからないところ
- 塩分の少ないところ
- 連続的な振動や過度の衝撃が加わらないところ
- 電磁ノイズ(溶接機、動力機器など)が少ないところ
- 放射性物質や磁場がなく、真空でないところ


■ 設置方法

モーターは耐振動性にすぐれ、熱伝導効果が高い平滑な金属板に設置してください。モーターを設置するときは 4 か所の取付穴を使用して、金属板との間にすき間がないように、4 本のボルト(付属していません)で固定してください。

設置方法A

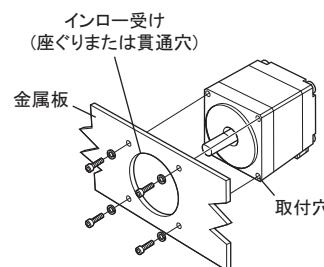

設置方法B

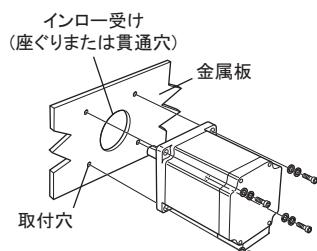

モーター タイプ	ボルトの呼び	締付トルク (N·m)	有効ねじ 深さ(mm)	設置方法
PKP21	M2 P0.4	0.25	2.5	A
PKP22	M2.5 P0.45	0.5	2.5	
PKP23	M3 P0.5	1	4.5	
PKP24	M4	2	-	
PKP26				B

■ 許容オーバーハング荷重と許容スラスト荷重

モーター出力軸にかかるオーバーハング荷重は、下表の許容値を超えないでください。スラスト荷重は、使用するモーターの質量を超えないでください。

モーター タイプ	許容オーバーハング荷重(N)				
	モーター出力軸先端からの距離				
	0 mm	5 mm	10 mm	15 mm	20 mm
PKP21	12	15	-	-	-
PKP22	25	34	52	-	-
PKP23	20	25	34	52	-
PKP24					
PKP26	61	73	90	110	160

■ 負荷の取り付け

負荷をモーターに取り付けるときは、モーター出力軸と負荷の軸中心線を揃えてください。カップリングやブーリーをモーター出力軸に取り付けるときは、出力軸や軸受けに損傷を与えないでください。


接続

重要

- ケーブルを固定して、屈曲や自重によるストレスが接続部に加わらないようにしてください。ケーブルの曲率半径は、できるだけ大きくしてください。
- PKP21 はコネクタ接続方式ではありません。
- PKP22、PKP23、PKP24、PKP26 の接続ケーブルを外すときは、出力軸方向へ水平に外してください。
- PKP23、PKP24、PKP26 の接続ケーブルはロック機能付コネクタを採用しています。コネクタを取り外すときは、ロックを解除してください。コネクタがロックされたまま強い力で引き抜くと、モーターが破損する原因になります。


■ PKP21

モーターは結線図にしたがって接続してください。

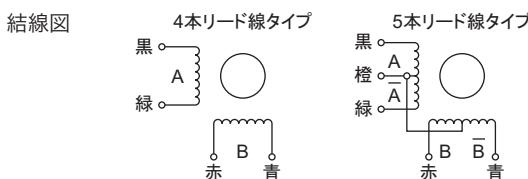

■ PKP22、PKP23、PKP24、PKP26

PKP22、PKP23、PKP24、PKP26 はコネクタ接続方式です。コネクタピン番号を確認して接続してください。

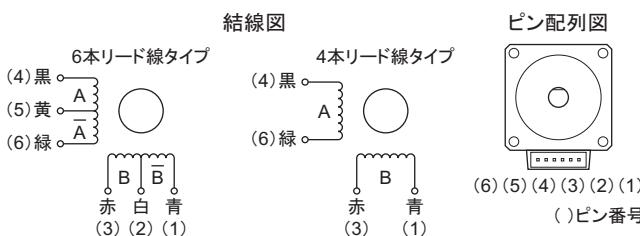

図のリード線色は、付属またはオプションの接続ケーブルを使った場合です。コネクタセットを使う場合やお客様がコネクタ、リード線を用意する場合は、図のピン番号で接続してください。

4本リード線タイプは、ピン番号(2)と(5)は使用しません。

■ 適合コネクタ・リード線

適合コネクタ、リード線は下表のとおりです。

モーター タイプ	ハウジング コンタクト (molex)	リード線	圧着工具 (molex)
PKP22	51065-0600 50212-8XXX	AWG30~24 (0.05~0.2 mm ²) 被覆外径 Ø1.4 mm 以下 ストリップ長さ 1.3~1.8 mm	57176-5000
PKP23 PKP24	51103-0600 50351-8XXX	AWG28~22 (0.08~0.3 mm ²) 被覆外径 Ø1.15~1.8 mm ストリップ長さ 2.3~2.8 mm	57295-5000
PKP26	51067-0600 50217-9XXX	AWG24~18 (0.2~0.75 mm ²) 被覆外径 Ø1.4~3 mm ストリップ長さ 3~3.5 mm	57189-5000 57190-5000

* オプション(別売)でコネクタセットや接続ケーブルを用意しています。

点検

モーターの運転後は、定期的に次の項目について点検することをおおすすめします。異常があるときは使用を中止し、お客様ご相談センターにお問い合わせください。

- モーター軸受部(ボールベアリング)などから異常な音が発生していないか。
- コネクタの接続部に緩みがないか、モーターリード線に傷、ストレスがないか。
- モーター出力軸と負荷軸に心ズレが出ていないか。

- この取扱説明書の一部または全部を無断で転載、複製することは、禁止されています。
- 取扱説明書に記載されている情報、回路、機器、および装置の利用に関して産業財産権上の問題が生じても、当社は一切の責任を負いません。
- 製品の性能、仕様および外観は改良のため予告なく変更することがありますのでご了承ください。
- 取扱説明書には正確な情報を記載するよう努めていますが、万一ご不審な点や誤り、記載もれなどにお気づきの点がありましたら、最寄りのお客様ご相談センターまでご連絡ください。
- Orientalmotor** は、日本その他の国におけるオリエンタルモーター株式会社の登録商標または商標です。

© Copyright ORIENTAL MOTOR CO., LTD. 2012

オリエンタルモーター株式会社

お問い合わせ窓口 (フリーコールです。携帯・PHSからもご利用いただけます。)

技術的なお問い合わせ・お見積・ご注文の 総合窓口

お客様ご相談センター

受付時間 平日8:00 ~ 20:00, 土曜日9:00 ~ 17:30

東京 TEL 0120-925-410 FAX 0120-925-601

名古屋 TEL 0120-925-420 FAX 0120-925-602

大阪 TEL 0120-925-430 FAX 0120-925-603

故障かな?と思ったときの
技術相談・訪問・検査修理窓口

アフターサービスセンター

受付時間 平日9:00 ~ 18:30

TEL 0120-911-271

FAX 0120-984-815

WEBサイトでもお問い合わせやご注文を受け付けています。<http://www.orientalmotor.co.jp/>

OPERATING MANUAL

2-Phase Stepping Motor PKP Series

Introduction

■ Before using the motor

Only qualified personnel should work with the product. Use the product correctly after thoroughly reading the section "Safety precautions". The product described in this manual has been designed and manufactured for use in general industrial machinery, and must not be used for any other purpose. For the power supply use a DC power supply with reinforced insulation on its primary and secondary sides. Oriental Motor Co., Ltd. is not responsible for any damage caused through failure to observe this warning.

■ Hazardous substances

RoHS (Directive 2002/95/EC 27Jan.2003) compliant

Safety precautions

The precautions described below are intended to prevent danger or injury to the user and other personnel through safe, correct use of the product. Use the product only after carefully reading and fully understanding these instructions.

⚠ Warning

Handling the product without observing the instructions that accompany a "Warning" symbol may result in serious injury or death.

- Do not use the product in explosive or corrosive environments, in the presence of flammable gases, locations subjected to splashing water, or near combustibles. Doing so may result in fire or injury.
- Assign qualified personnel the task of installing, wiring, operating/controlling, inspecting and troubleshooting the product. Failure to do so may result in fire or injury.
- Provide a means to hold moving parts in place for applications involving vertical travel. The motor loses holding torque when the power is shut off, allowing the moving parts to fall and possibly causing injury or damage to equipment.
- Install the motor in an enclosure in order to prevent injury.
- Keep the input-power voltage within the specified range to avoid fire.
- Connect the motor lead wires securely according to the wiring diagram in order to prevent fire.
- Do not forcibly bend or push the connector. Doing so may fire.
- Do not forcibly bend, pull or pinch the motor lead wire. Doing so may fire.
- For the power supply use a DC power supply with reinforced insulation on its primary and secondary sides. Failure to do so may result in electric shock.
- Turn off the power in the event of a power failure, or the motor will suddenly start when the power is restored and may cause injury or damage to equipment.
- Do not disassemble or modify the motor. This may cause injury. Refer all such internal inspections and repairs to the branch or sales office from which you purchased the product.

⚠ Caution

Handling the product without observing the instructions that accompany a "Caution" symbol may result in injury or property damage.

- Do not use the motor beyond its specifications, or injury or damage to equipment may result.
- Do not touch the motor during operation or immediately after stopping. The surface is hot and may cause a skin burn(s).
- Do not hold the motor output shaft or motor lead wire. This may cause injury.

Thank you for purchasing an Oriental Motor product. This Operating Manual describes product handling procedures and safety precautions.

- Please read it thoroughly to ensure safe operation.
- Always keep the manual where it is readily available.

- Provide an emergency-stop device or emergency-stop circuit external to the equipment so that the entire equipment will operate safely in the event of a system failure or malfunction. Failure to do so may result in injury.
- Conduct the insulation resistance measurement or withstand voltage test separately on the motor and the driver. Conducting the insulation resistance measurement or withstand voltage test with the motor and driver connected may result in injury or damage to equipment.
- To prevent bodily injury, do not touch the rotating parts (output shaft) of the motor during operation.
- Immediately when trouble has occurred, stop running and turn off the driver power. Failure to do so may result in fire or injury.
- To dispose of the motor, disassemble it into parts and components as much as possible and dispose of individual parts/components as industrial waste.

Checking the product

Confirm that all of the following items are available. To verify that the unit you've purchased is the correct one, check the model number shown on the nameplate. Should you find any item missing or damaged, contact the Oriental Motor sales office where you purchased the product.

- Motor 1 unit
- Connection cable [0.6 m (2 ft.)] 1 pc. (PKP2□-L only)
* □ represents alphanumeric characters indicating the motor type.
- OPERATING MANUAL (this manual) 1 copy

Installation

■ Location for installation

The motor is designed and manufactured for installation in equipment. Install it in a well-ventilated location that provides easy access for inspection. The location must also satisfy the following conditions:


- Inside an enclosure that is installed indoors (provide vent holes)
- Operating ambient temperature -10 to +50 °C (+14 to +122 °F) (non-freezing)
- Operating ambient humidity 85% or less (non-condensing)
- Area that is free of explosive atmosphere or toxic gas (such as sulfuric gas or liquid)
- Area not exposed to direct sun
- Area free of excessive amount of dust, iron particles or the like
- Area not subject to splashing water (rain, water droplets), oil (oil droplets) or other liquids
- Area free of excessive salt
- Area not subject to continuous vibration or excessive shocks
- Area free of excessive electromagnetic noise (from welders, power machinery, etc.)
- Area free of radioactive materials, magnetic fields or vacuum

■ How to install the motor

Install the motor onto an appropriate flat metal plate having excellent vibration resistance and heat conductivity. When installing the motor, secure it with four bolts (not supplied) through the four mounting holes provided. Leave no gap between the motor and plate.


Installation method A

Mounting-pilot holder
(countersunk or drilled through)

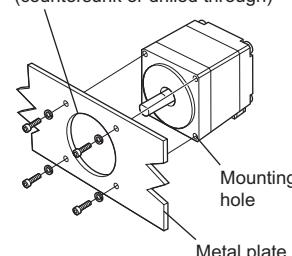

Installation method B

Mounting-pilot holder
(countersunk or drilled through)

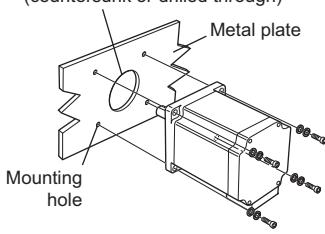

Motor type	Bolt size	Tightening torque [N·m (lb-in)]	Effective depth [mm (in.)]	Installation method
PKP21	M2 P0.4	0.25 (2.2)	2.5 (0.1)	A
PKP22	M2.5 P0.45	0.5 (4.4)	2.5 (0.1)	
PKP23	M3 P0.5	1 (8.8)	4.5 (0.18)	
PKP24	M4	2 (17.7)	-	
PKP26				B

■ Permissible overhung load and permissible thrust load

The overhung load on the motor's output shaft or gear output shaft must be kept within the permissible values listed below. The thrust load must not exceed the motor's mass.

Motor type	Permissible overhung load [N (lb.)]				
	Distance from the top of motor's output shaft [mm (in.)]				
	0 (0)	5 (0.2)	10 (0.39)	15 (0.59)	20 (0.79)
PKP21	12 (2.7)	15 (3.3)	-	-	-
PKP22	25 (5.6)	34 (7.6)	52 (11.7)	-	-
PKP23	20 (4.5)	25 (5.6)	34 (7.6)	52 (11.7)	-
PKP24	20 (4.5)	25 (5.6)	34 (7.6)	52 (11.7)	-
PKP26	61 (13.7)	73 (16.4)	90 (20)	110 (24)	160 (36)
PKP26□■A	49 (11)	60 (13.5)	79 (17.7)	110 (24)	-

* □ represents alphanumeric characters indicating the motor type.

Enter **A** (single shaft) or **B** (double shaft) in the box (□) within the model name.

■ Installing a load

When connecting a load to the motor, align the centers of the motor's output shaft and load shaft. Be careful not to damage the output shaft or the bearings when installing a coupling or pulley to the motor's output shaft.

Connection


Note

- Secure the cable in place so that the connection won't be subjected to stress induced by a bent cable or the cable's own mass. The cable's radius of curvature should be as large as possible.
- PKP21** is not connector type motor.
- When removing the connection cable for **PKP22**, **PKP23**, **PKP24** and **PKP26**, pull it out horizontally toward the output shaft.
- The connection cable for **PKP23**, **PKP24** and **PKP26** employs a connector with a lock. When removing this type of cable, release the connector lock first. Forcibly pulling out the cable without releasing the connector lock may damage the motor.

■ PKP21

Connect the motor according to the wiring diagram.


Wiring diagram

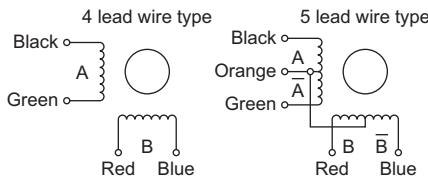

■ PKP22, PKP23, PKP24, PKP26

PKP22, **PKP23**, **PKP24** and **PKP26** are connector type motor. Check the connector pin numbers, and connect them correctly.

Wiring diagram

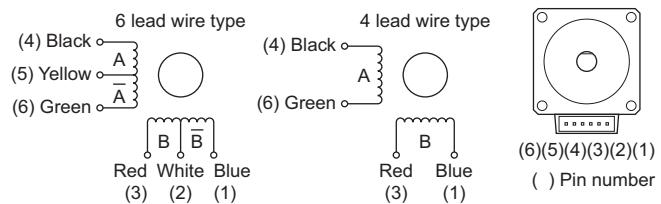

The colors of lead wires shown apply to the supplied connection cable or optional connection cable. If you are using the connector set or when you are providing your own connector or lead wire, connect based on the pin numbers shown.

If the 4 lead wire type is used, pin number (2) and (5) are not required.

■ Conforming connector and lead wire

The conforming connector and the lead wire are as follows.

Motor type	Housing Contact (Molex)	Lead wire	Crimping tool (Molex)
PKP22	51065-0600 50212-8XXX	AWG30 to 24 (0.05 to 0.2 mm ²) Outer sheath diameter: Ø1.4 mm (0.055 in.) or less Strip length: 1.3 to 1.8 mm (0.051 to 0.071 in.)	57176-5000
PKP23 PKP24	51103-0600 50351-8XXX	AWG28 to 22 (0.08 to 0.3 mm ²) Outer sheath diameter: Ø1.15 to 1.8 mm (0.045 to 0.071 in.) Strip length: 2.3 to 2.8 mm (0.091 to 0.111 in.)	57295-5000
PKP26	51067-0600 50217-9XXX	AWG24 to 18 (0.2 to 0.75 mm ²) Outer sheath diameter: Ø1.4 to 3 mm (0.055 to 0.118) Strip length: 3 to 3.5 mm (0.118 to 0.138 in.)	57189-5000 57190-5000

* Optional connection cable and connector set (sold separately) are available from Oriental Motor.

Inspection

It is recommended that periodic inspections be conducted for the items listed below after each operation of the motor. If an abnormal condition is noted, discontinue any use and contact your nearest office.

- Check for any unusual noises in the motor's bearings (ball bearings) or other moving parts.
- Are there any loose connector connections, or any scratches or signs of stress in the motor lead wire?
- Are the motor's output shaft and load shaft out of alignment?

- Unauthorized reproduction or copying of all or part of this manual is prohibited.
- Oriental Motor shall not be liable whatsoever for any problems relating to industrial property rights arising from use of any information, circuit, equipment or device provided or referenced in this manual.
- Characteristics, specifications and dimensions are subject to change without notice.
- While we make every effort to offer accurate information in the manual, we welcome your input. Should you find unclear descriptions, errors or omissions, please contact the nearest office.
- Orientalmotor** is a registered trademark or trademark of Oriental Motor Co., Ltd., in Japan and other countries.

© Copyright ORIENTAL MOTOR CO., LTD. 2012

- Please contact your nearest Oriental Motor office for further information.

ORIENTAL MOTOR U.S.A. CORP.
Technical Support Tel:(800)468-3982
www.orientalmotor.com

ORIENTAL MOTOR DO BRASIL LTDA.
Tel:+55-11-3266-6018
www.orientalmotor.com.br

ORIENTAL MOTOR (EUROPA) GmbH
Headquarters Düsseldorf, Germany
Technical Support Tel:00 800/22 55 66 22
www.orientalmotor.de

ORIENTAL MOTOR (UK) LTD.
Tel:01256-347090
www.oriental-motor.co.uk

ORIENTAL MOTOR (FRANCE) SARL
Tel:01 47 86 97 50 www.orientalmotor.fr

ORIENTAL MOTOR ITALIA s.r.l.
Tel:02-93906346 www.orientalmotor.it

ORIENTAL MOTOR CO., LTD.
Headquarters Tokyo, Japan
Tel:03-6744-0361
www.orientalmotor.co.jp

ORIENTAL MOTOR ASIA PACIFIC PTE. LTD.
Singapore
Tel:1800-8420280 www.orientalmotor.com.sg

ORIENTAL MOTOR (MALAYSIA) SDN. BHD.
Tel:1800-806161 www.orientalmotor.com.my

ORIENTAL MOTOR (THAILAND) CO., LTD.
Tel:1800-888-881 www.orientalmotor.co.th

ORIENTAL MOTOR (INDIA) PVT. LTD.
Tel:+91-80-41125586 www.orientalmotor.co.in

TAIWAN ORIENTAL MOTOR CO., LTD.
Tel:0800-060708 www.orientalmotor.com.tw

SHANGHAI ORIENTAL MOTOR CO., LTD.
Tel:400-820-6516 www.orientalmotor.com.cn

INA ORIENTAL MOTOR CO., LTD.
Korea
Tel:080-777-2042 www.inaom.co.kr

ORIENTAL MOTOR CO., LTD.
Hong Kong Branch
Tel:+852-2427-9800